Local catalogue draft · Preview only. Product data and documents are not released. Open catalogue review

Draft with publication block

This view is not engineering approval. Open and withheld information remains unresolved.

▶ 8 open or withheld review cases



Product view 1 / 1

ADAPTORS / JOINT PARTS

080/Ø48 Adaptor

Article number
X-M-TRA01

REQUEST A QUOTE

The fixed support-arm adapter provides the transition from the profile connection of the X-M system to a Ø48 mm tubular profile. It joins these different connection forms in a support-arm assembly and is designed as a rigid connecting component. The tubular profile connects to the round-tube side of the adapter. A separate panel-side adapter provides the operator enclosure connection, so the two transitions serve different functions.

Weight
1,000 g

Material
Aluminum

Colour
RAL 7035 / Cover RAL 7016

Package Dimensions
190 × 80 × 120 mm

HS Code
7606.99.90.19

Warranty
5 years

Technical data

Specifications for planning, selection and use at a glance.

Material & finish

Material Composition	Aluminum
Colour	RAL 7035 / Cover RAL 7016
RAL colours	RAL 7035 / RAL 7016

Application & function

Operating Weight	1,000 g
Primary Use Case	Machine Building / Automation / HMI operator stations
Operating Temperature	–40°C to +70°C
Protection Rating	–IP65 (DIN EN 60529)
Rated Voltage	Mechanical (not subject to electrical certification)
Movement	Fixed

Safety & compliance

Earthing	Yes, integrated solution
RoHS Compliance	RoHS EU Directive 2011/65/EU
REACH Compliance	REACH Regulation 1907/2006/EC
Certification	IEC 60529; (EG) No. 765/2008; (EU) 2023/956

Further information

Movement type	fest

Ordering & delivery information

Package dimensions

190 × 80 × 120 mm

Pack quantity

1

HS Code

7606.99.90.19

Warranty

5 years

Version & enquiry

Use the item number and version to prepare your enquiry.

SKU ↑	WEIGHT (G) ↑↓	Choose a version
SKU: X-M-TRA01	1000	Select


Assembly instructions

▶ About these instructions

Assembly sequence prepared from the exact XINDUX article data sheet. Tightening torques not specified in the source document are deliberately not added.

▼ Preparation & tools


Supplied and installation parts

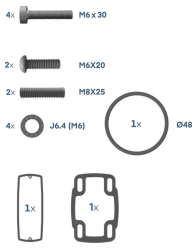

Required tools

Allen key suitable for the fasteners

Torque wrench for the final engineering check

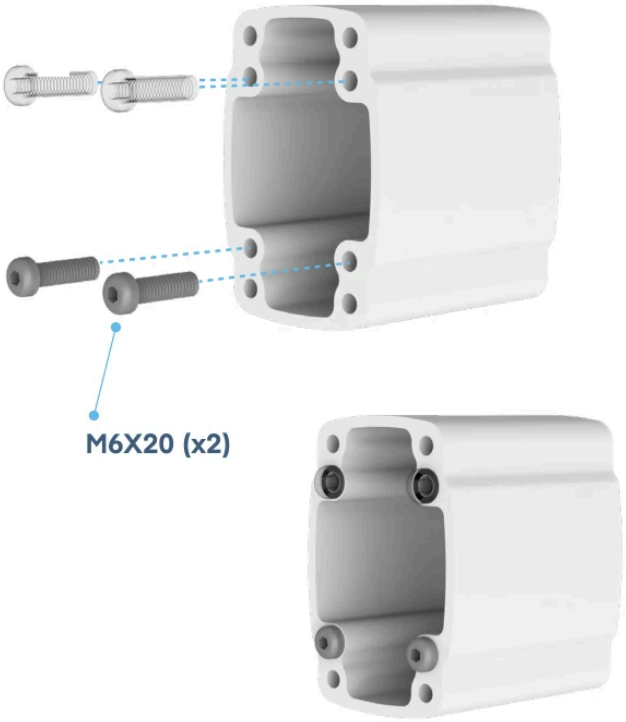

1. Fasten the connection

Insert the angle bolts into their slots and tighten.

- M6 × 20




2. Insert the gasket

Remove the yellow tape. Insert the profile-side connection seal with the adhesive surface to the component into the seal holder shown without folds.



3. Connect the profile


Completely establish the first profile connection shown.

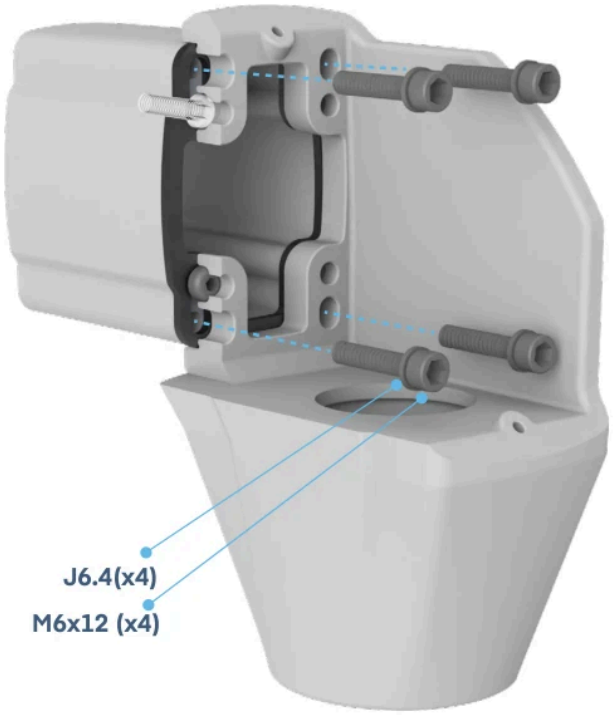

4. Fasten the connection

Tighten the profile bolts.

- M6 × 12
- J6.4

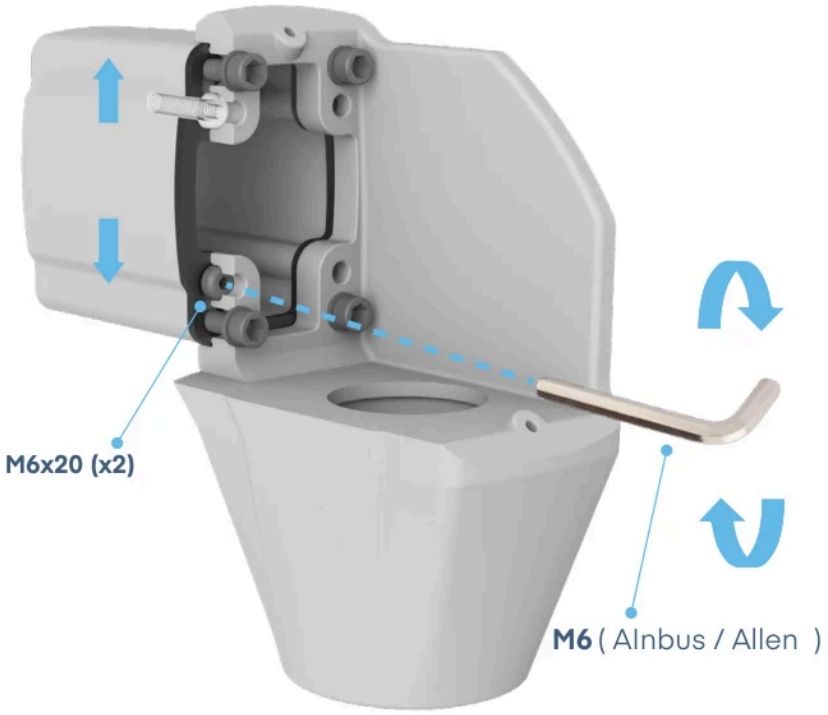

5. Align the system

Angle bolts are used to prevent the profile from sagging due to the heavy weight that can occur with long support arm profiles. M6 × 20 angle bolts are used to prevent profile sagging due to the heavy weight that can occur with long support arm profiles. If sagging does not occur in your application, leave the angle bolts in the tightened position. If there is deflection in your application, loosen the M6 × 30 profile bolts by 2-3mm depending on the desired angle. Once the profile is adjusted to the desired position, retighten the M6 × 30 angle screws. Then check the inclination with a spirit level.

- M6
- M6 × 20
- M6 × 30



6. Insert the gasket

Remove the yellow tape. Insert the cover seal with the adhesive surface to the black cover into its contour without folds.



7. Fit the cover


Place the cover on the module and tighten the screws.

- M4 × 8




8. Insert the gasket

Insert the gasket.

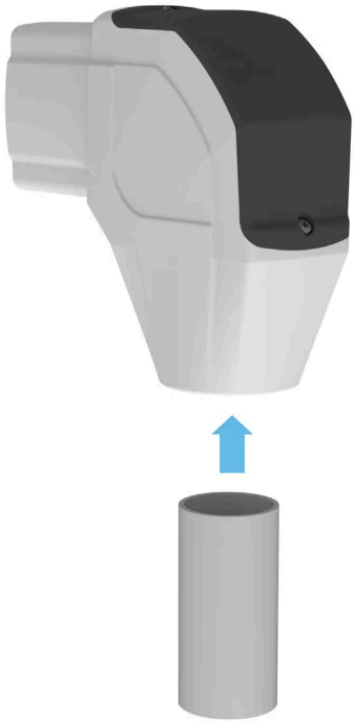

9. Connect the profile

Completely establish the second profile connection shown.

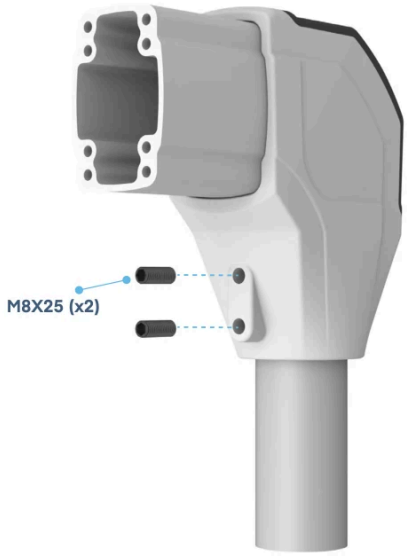

10. Set the rotation range

Tighten the set screws.

- M8 × 25